Software Release for: ThurayaIP+

Release number: 2.0.4.9

Release date: Thu, 2-Feb-2023, 01:50 pm PST

Path to files: Web: http://sdweb/thuraya/thip2/releases/2.0.4.9

Windows: \\pcnfs2\projects\thip2\releases\2.0.4.9

UNIX: /sd/proj/thip2/releases/2.0.4.9

Generated by: igilbert

Comment: Fix for SPR 17471

Release Elements

Binary image: **thip2.bin**Build timestamp: **2/2/2023 13:49**

(per the *print_release* shell command)

Firmware version: **04.04**PIC version: **2.0.1.1**

SPRs Fixed

Links in the table below go directly to the SPR in DETS, presuming you have logged-in already. This bypasses the DETS navigation bar, so you will be able to access the SPR, but not navigate to others.

SPR#	Description	Date	Resolution
17471	THIP+: Relay mode in new HW takes up to 30mins to be assigned with a global IP address	2022-08-26	fixed

NOTE: Content of table above depends on developers' inclusion of SPR number(s) in SRRs and timely update of SPR status in DETS. Table extracted from DETS at: 13:51 2-Feb-2023

SRR Summary:

SRR#	Elems	User	View	Date	SPRs Fixed
1234	3	igilbert	thip2_igilbert	Wed Feb 1 07:56:48 2023	
1235	2	igilbert	thip2_igilbert	Thu Feb 2 12:50:15 2023	17471

SRRs Approved for 2.0.4.9

SRR # 1234

```
THIP2 SOFTWARE RELEASE REQUEST # 1234
Submitted By: igilbert
                      Wed Feb 1 07:56:48 2023
View
           : thip2_igilbert
Revisions/Modifications:
Fixes for WLAN UART communication on PXA255, switching WLAN interfaces
This SRR corrects an issue on Thuraya IP+ Mobility terminals that prevented them from communicating with the WLAN chipset over the UART interface. T
Additionally, this SRR corrects an issue with certain select() calls in the WLAN driver where the fdset being supplied was not cleared before adding
SPECIFIC FILE CHANGES
pxa255Gpio.c:
 Updated the initial configuration of GPIO 9 (PXA255_GPIO_WLAN_MSEL) on PXA255 terminals to an output with an initial level of high. This corrects
wlan_ctrl.c:
wlan upgrd.c:
- Before calling certain select() calls, make sure that fdset being used is cleared using FD_ZERO() before setting the WLAN interface file descripto
  .....
Elements Released:
/cm_data/dslp/sw/src/platform/wlan/wlan_ctrl.c@@/main/66
/cm_data/dslp/sw/src/platform/wlan/wlan_upgrd.c@@/main/25
/cm_data/dslp/sw/src/vxworks/target/config/dslp/pxa255Gpio.c@@/main/30
```

SRR # 1235

1	
THIP2 SOFTWARE RELEASE REQUEST # 1235	
Submitted By: igilbert Thu Feb 2 12:50:15 2023	
View : thip2_igilbert	
Revisions/Modifications:	
Re-implementation of fix for SPR 17471	
This SRR reinstates the fix for SPR 17471 by setting the default DHCP lease time to 5 minutes, to prevent cases where the TE may experience a lor	ıg
SPECIFIC FILE CHANGES	
dhcp_dns.c: dhcp_dns.c: - Updated the values of DHCPS_DEFAULT_LEASE_LONG and DHCPS_MAX_LEASE_LONG to 300 seconds to correct SPR 17471, where the TE may experience a dela	ìу
dhcp.c: - Added an enhancement to function dhcp_dns_update() which checks whether the terminal is in relay mode before assigning new DHCP lease times. If	i i
SPRs Fixed: 17471	
Elements Released: /cm_data/dslp/sw/src/vxworks/target/config/dslp/dhcps.c@@/main/18 /cm_data/dslp/sw/src/vxworks/target/config/dslp/dhcps_dns.h@@/main/7	
+	