


Installation Notes for Thuraya IP firmware 1.0.7.2

We have observed few cases of installation failures in some Windows 7 systems with the below pop up error message which mention about MSSTDFMT.DLL file.

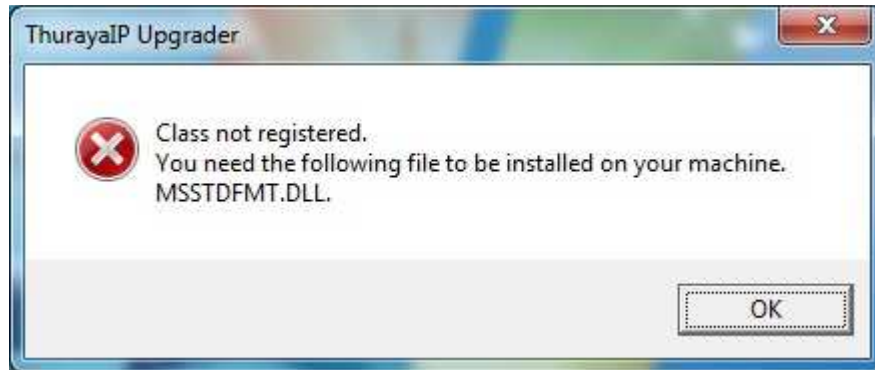

In case you encounter this problem, please follow the below instructions:

- 1) Download MSSTDFMT.DLL file from Thuraya IP webpage
<http://www.thuraya.com/thuraya-ip-upgrader>
- 2) Copy MSSTDFMT.DLL into C:\windows\system\
- 3) Go to RUN and type "regsvr32 c:\windows\system\msstdfmt.dll"
- 4) Now reinstall the upgrader application